

Inspection - Detection



360° Spray System for all angle use



MOD Approval

FLAW DETECTOR CLEANER 1

CLEANER FOR NON-DESTRUCTIVE TESTING

Quick drying solvent cleaner/degreaser and excess penetrant remover for the non-destructive testing of metal surfaces by liquid penetrant inspection. Many cracks in engineering materials can be deep in spite of having a very small opening width on the surface and can cause very serious defects. By normal visual inspection such cracks may be very difficult to detect, but penetrant flaw detection is an extension of the visual inspection method highlighting otherwise invisible defects. The control is carried out using 3 products: Flaw Detector Cleaner, Flaw Detector Penetrant and Flaw Detector Developer.

Flaw Detector Cleaner is a fast drying, powerful degreasing solvent blend free of 1,1,1-trichloroethane or other chlorinated solvents for the removal of dirt, grime and contaminants. Designed for the pre-treatment of the surface, prior to liquid penetrant inspection and to remove all visible, colored traces of the penetrant.

It quickly dissolves grease, oil, lubricants, tar and adhesives and its effective wash-away of contaminants and colored penetrant.

Flaw Detector Cleaner is stable, non-staining and non-corrosive, leaves no residue. Fast evaporation to minimize downtime.

- ASME Code Section V

PRODUCT CODES / FILL SIZES



30288 / 400ml

APPLICATIONS

Non-destructive inspection of materials, parts, assemblies, equipment, surfaces or structures:

- Cracks, lack of fusion and open cavities in welded parts.
- Cracks and cavities caused by metal fatigue and cutting operations.
- Check of porosity or leaks in pipes, tanks, boilers, heat exchangers.
- Discontinuities, laps, folds and cracks in castings, forgings and ceramics. · Safe on most plastics, coatings and rubbers (test prior to use).

TECHNICAL DATA (WITHOUT PROPELLANT)

Appearance	colorless liquid, typical odour
Specific gravity (@ 20°C)	0.716
Boiling range	55 - 120°C
Vapor density (vs air = 1)	3
Freezing point	< -30°C
Evaporation rate (vs ether = 1)	2.8
Flash point (closed cup)	< 0°C
Dynamic viscosity (@ 20°C)	0.5 mPa.s
Surface tension (@ 20°C, est.)	21 mN/m
Plastics compatibility	to be checked (*)
Non-volatiles	none
(*) Sensitive plastics (e.g. polystyrenes and polycarbonates, need to be checked, particularly when thermal or mechanical stress is involved).	

DIRECTIONS

- Do not use at ambient temperatures below 10°C.
- In liquid penetrant inspections, the test object or material is coated with a visible dye solution. The excess dye is removed from the surface and a developer is then applied. The developer acts like a blotter and draws penetrant out of the imperfections of the surface. With visible dyes, the vivid colour contrast between the penetrant and the developer makes the 'bleed-out' easy to see.

Cleaning of the surface

- The surface to be checked must be clean, degreased and dry. All soiling like rust, oil, grease, paint etc, which can mask the imperfections, must be removed. Finish the cleaning by spraying Flaw Detector Cleaner generously. If possible wipe with an absorbent cloth and allow drying thoroughly.

Penetrant application

- Shake the can of Flaw Detector Penetrant prior to use. Spray the penetrant in a light, even film on the surface, wetting all areas to be controlled. Allow to drain for 10 to 20 minutes.

Excess penetrant removal

- Remove excess of penetrant by wiping the surface using a lint-free cloth. Apply water (Flaw Detector Penetrant is water washable) until all visible, coloured traces are removed. Care must be taken that only disturbing penetrant on the surface is removed. Dry properly.

Development

- Shake the can of Flaw Detector Developer thoroughly prior to use. Spray a light, homogeneous coat of developer from a distance of about 20 cm. Avoid any excess developer to avoid masking the finest flaws. Allow to develop for at least 7 minutes so that imperfections are visible.

Visual inspection of defects

- As time passes, the defects will appear as red spots or lines on a white background. The speed of appearance, the shape and dimensions can give information about the nature of the defects. If necessary, post-clean the controlled surface and protect against corrosion with one of Ambersil's corrosion protection products, such as Corrosion Inhibitor.

STORAGE & SHELF LIFE

The product may be stored at normal ambient temperatures and has a shelf life of not less than 6 years with correct storage. Aerosols should always be stored below 50°C, away from direct heat and naked flame.

HEALTH AND SAFETY

A separate Safety Data Sheet (SDS) according to EC Regulation 73/404/EEC and 648/2004/EC is available from Ambersil.com or via info.uk@crcind.com

MISREPRESENTATION ACT 1967

TRADE DESCRIPTIONS ACT 1968

The information given in this publication is based on our experience and reports from customers. There are many factors outside our control and knowledge which affect the use and performance of our products and for which reason no warranty is given, express or implied. Users should make their own tests to determine the applicability of such information or the suitability of any products for their own particular purposes. Statements concerning the use of the products described herein are not to be construed as recommending the infringement of any patent and no liability for infringement arising out of any such use is to be assumed.

Version 3.1
Created: July 2019
Updated: October 2020

CRC Industries UK Ltd.
Wylds Road, Bridgwater
Somerset, TA6 4DD
United Kingdom

t +44 (0)1278 727200
f +44 (0)1278 425644
e sales.uk@crcind.com
w www.ambersil.com

Company Registered No. 04910479

VAT No. GB 821 5195 42





Inspection - Detection



360° Spray System for all angle use



MOD Approval

FLAW DETECTOR PENETRANT 2

PENETRANT FOR NON-DESTRUCTIVE TESTING

A red coloured liquid penetrant for the non-destructive testing of surfaces and structures. Many cracks in engineering materials can be deep in spite of having a very small opening on the surface, resulting in very serious or critical defects. Such cracks may be very difficult to detect by normal visual inspection and

penetrant flaw detection provides an extension of the visual inspection method. The inspection is carried out using 3 products: Flaw Detector Cleaner, Flaw Detector Penetrant and Flaw Detector Developer. Flaw Detector Penetrant is a water washable liquid penetrant easily visible under natural white light.

The inspection can be carried out with ready-to-use aerosols and the results are produced quickly and easily.

An economical technology with no need for expensive and advanced equipment. Wicks in to defects down to 30 µm.

A sensitive and reliable test method, widely applicable, regardless the nature of the materials and shape of the objects.

- ASME Code Section V

PRODUCT CODES / FILL SIZES



30289 / 400ml

APPLICATIONS

Non-destructive inspection of materials, parts, assemblies, equipment, surfaces and structures:

- Detects cracks, lack of fusion, and open cavities in welded parts.
- Finds cracks and cavities caused by metal fatigue and cutting operations.
- Checks for porosity or leaks in pipes, tanks, boilers, heat exchangers.
- Identifies discontinuities, folds and cracks in castings, forgings and ceramics.

TECHNICAL DATA (WITHOUT PROPELLANT)

Appearance	Red liquid
Odour	Solvent
Specific gravity (@ 20°C)	0.816
Boiling range (solvent)	180 - 250°C
Flash point liquid	> 70°C
Auto-ignition temperature	> 200°C
Solubility in water	Water washable

DIRECTIONS

- Do not use at ambient temperatures below 10°C.
- In liquid penetrant inspections, the test object or material is coated with a visible dye solution. The excess dye is removed from the surface and a developer is then applied. The developer acts like a blotter and draws penetrant out of the imperfections of the surface. With visible dyes, the vivid colour contrast between the penetrant and the developer makes the 'bleed-out' easy to see.

Cleaning of the surface

- The surface to be checked must be clean, degreased and dry. All soil such as rust, oil, grease, paint etc, which can mask the imperfections, must be removed. Finish the cleaning by spraying Flaw Detector Cleaner generously. Wipe with an absorbent cloth and allow to dry thoroughly.

Penetrant application

- Shake the can of Flaw Detector Penetrant prior to use. Spray the penetrant in a light, even film on the surface, wetting all areas to be inspected. Allow to drain for 10 to 20 minutes.

Excess penetrant removal

- Remove excess of penetrant by wiping the surface using a lint-free cloth. Apply water (Flaw Detector Penetrant is water washable) until all visible, coloured traces are removed. Care must be taken that only penetrant on the surface is removed. Dry properly.

Development

- Shake the can of Flaw Detector Developer thoroughly prior to use. Spray a light, homogeneous coat of Developer from a distance of about 20 cm. Avoid any excess Developer (to avoid masking the finest flaws). Allow to develop for at least 7 minutes so that imperfections are visible.

Visual inspection of defects

- Defects will appear as red spots or lines on a white background. The speed of appearance, the shape and dimensions, can give information about the nature of the defects. If necessary, after inspection clean the surface with cleaner, and protect against corrosion with one of Ambersil's corrosion protection products such as Ambersil Corrosion Inhibitor.

NOTE: When used on certain magnesium alloys, light discolouration may occur after extremely prolonged time with Flaw Detector Penetrant.

STORAGE & SHELF LIFE

The product may be stored at normal ambient temperatures and has a shelf life of not less than 6 years with correct storage. Aerosols should always be stored below 50°C, away from direct heat and naked flame.

HEALTH AND SAFETY

A separate Safety Data Sheet (SDS) according to EC Regulation 73/404/EEC and 648/2004/EC is available from Ambersil.com or via info.uk@crcind.com

MISREPRESENTATION ACT 1967

TRADE DESCRIPTIONS ACT 1968

The information given in this publication is based on our experience and reports from customers. There are many factors outside our control and knowledge which affect the use and performance of our products and for which reason no warranty is given, express or implied. Users should make their own tests to determine the applicability of such information or the suitability of any products for their own particular purposes. Statements concerning the use of the products described herein are not to be construed as recommending the infringement of any patent and no liability for infringement arising out of any such use is to be assumed.

Version 3.1
Created: July 2019
Updated: October 2020


CRC Industries UK Ltd.
Wylde Road, Bridgwater
Somerset, TA6 4DD
United Kingdom

t +44 (0)1278 727200
f +44 (0)1278 425644
e sales.uk@crcind.com
w www.ambersil.com

Company Registered No. 04910479

VAT No. GB 821 5195 42



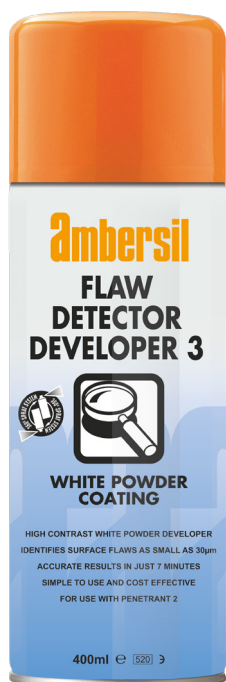

Inspection - Detection



MOD Approval

FLAW DETECTOR DEVELOPER 3

DEVELOPER FOR NON-DESTRUCTIVE TESTING

A quick drying developer, for the non-destructive testing of surfaces and structures. Many cracks in engineering materials can be deep in spite of having a very small opening on the surface, and can cause very serious or critical defects. By normal visual inspection such cracks may be very difficult to detect, but penetrant flaw detection is an extension of the visual inspection method. The inspection is carried out using 3 products: Flaw Detector Cleaner, Flaw Detector Penetrant and Flaw Detector Developer. Flaw Detector Developer is a dispersion of a white powder in a fast evaporating solvent, giving a high contrast visual reference.

The inspection can be carried out with ready-to-use aerosols and the results are produced quickly and easily.

An economical technology with no need for expensive and advanced equipment. Identifies defects as small as 30µm.

A sensitive and reliable test method, widely applicable, regardless the nature of the materials and shape of the objects.

- ASME Code Section V

PRODUCT CODES / FILL SIZES



30290 / 400ml

APPLICATIONS

Non-destructive inspection of materials, parts, assemblies, equipment, surfaces and structures:

- Detects cracks, lack of fusion, and open cavities in welded parts.
- Finds cracks and cavities caused by metal fatigue and cutting operations.
- Check for porosity or leaks in pipes, tanks, boilers, heat exchangers.
- Discontinuities, laps, folds and cracks in castings, forgings and ceramics.

TECHNICAL DATA (WITHOUT PROPELLANT)

Appearance	Powder dispersed in a solvent blend
Color	White
Odour	Solvent
Application temperature	> 10°C
Specific gravity (@ 20°C)	0.781
Boiling range (solvent)	40 - 65°C
Flash point liquid	< 0°C
Auto-ignition temperature	> 200°C
Solubility in water	Not soluble

DIRECTIONS

- Do not use at ambient temperatures below 10°C.
- In liquid penetrant inspections, the test object or material is coated with a visible dye solution. The excess dye is removed from the surface and a developer is then applied. The developer acts like a blotter and draws penetrant out of the imperfections of the surface. With visible dyes, the vivid colour contrast between the penetrant and the developer makes the 'bleed-out' easy to see.

Cleaning of the surface

- The surface to be checked must be clean, degreased and dry. All soil such as rust, oil, grease, paint etc, which can mask the imperfections, must be removed. Finish the cleaning by spraying Flaw Detector Cleaner generously. If possible wipe with an absorbent cloth and allow to dry thoroughly.

Penetrant application

- Shake the can of Flaw Detector Penetrant prior to use. Spray the penetrant in a light, even film on the surface, wetting all areas to be inspected. Allow to drain for 10 to 20 minutes.

Excess penetrant removal

- Remove excess of penetrant by wiping the surface using a lint-free cloth. Apply water (Flaw Detector Penetrant is water washable) until all visible, coloured traces are removed. Care must be taken that only penetrant on the surface is removed. Dry properly.

Development

- Shake the can of Flaw Detector Developer thoroughly prior to use. Spray a light, homogeneous coat of Developer from a distance of about 20 cm. Avoid any excess Developer (to avoid masking the finest flaws). Allow to develop for at least 7 minutes so that imperfections are visible.

Visual inspection of defects

- As time passes, the defects will appear as red spots or lines on a white background. The speed of appearance, the shape and dimensions, can give information about the nature of the defects. If necessary, after inspection clean the surface with cleaner, and protect against corrosion with one of Ambersil's corrosion protection products such as Ambersil Corrosion Inhibitor.

STORAGE & SHELF LIFE

The product may be stored at normal ambient temperatures and has a shelf life of not less than 6 years with correct storage. Aerosols should always be stored below 50°C, away from direct heat and naked flame.

HEALTH AND SAFETY

A separate Safety Data Sheet (SDS) according to EC Regulation 73/404/EEC and 648/2004/EC is available from Ambersil.com or via info.uk@crcind.com

MISREPRESENTATION ACT 1967

TRADE DESCRIPTIONS ACT 1968

The information given in this publication is based on our experience and reports from customers. There are many factors outside our control and knowledge which affect the use and performance of our products and for which reason no warranty is given, express or implied. Users should make their own tests to determine the applicability of such information or the suitability of any products for their own particular purposes. Statements concerning the use of the products described herein are not to be construed as recommending the infringement of any patent and no liability for infringement arising out of any such use is to be assumed.

Version 3.1
Created: July 2019
Updated: October 2020

CRC Industries UK Ltd.
Wylds Road, Bridgwater
Somerset, TA6 4DD
United Kingdom

t +44 (0)1278 727200
f +44 (0)1278 425644
e sales.uk@crcind.com
w www.ambersil.com

Company Registered No. 04910479

VAT No. GB 821 5195 42

